
Standard Uni-Orbital Connector

VT139


Installation Instructions

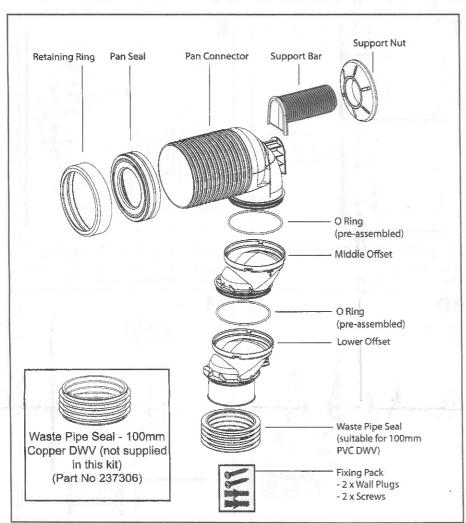


Long Uni-Orbital Connector Contents

REAR VIEW

3

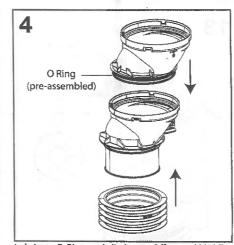


Lubricate O-Ring and clip Lower Offset and Middle Offset together. Lubricate Waste Pipe Seal and slide onto Lower Offset. (Liquid soap is recommended)

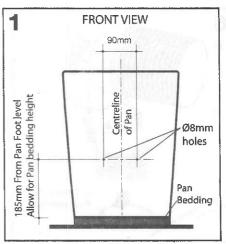


Mark centreline of Pan on wall.


Drill 2 x Ø8mm holes and insert wall plugs supplied

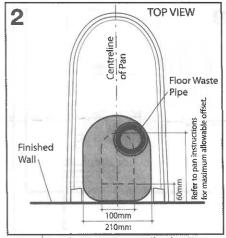


Dotted line indicates maximum offset for Waste Pipe centreline. Floor Waste Pipe must fit within shaded area.

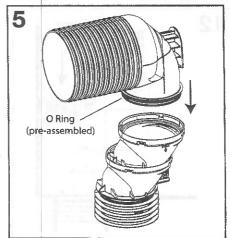

 
Lubricate O-Ring and clip Pan Connector and Middle offset together.




Installation Instructions

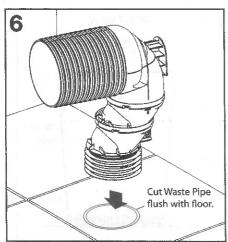


Position Uni-Orbital Connector over Floor Waste Pipe without inserting.

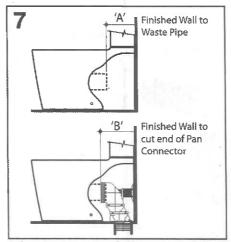


Refer to Pan instructions for dimension 'A' - finished wall to Waste Pipe. Dimension 'B' = 'A' + 35mm

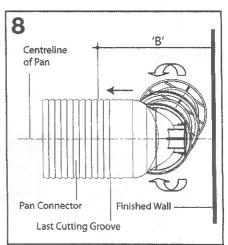


Position axis of Pan Connector on centreline of Pan. Rotate forward and bring last cutting groove as close as possible behind dimension 'B'

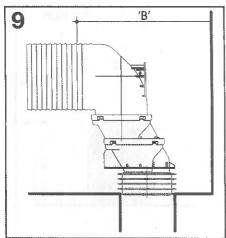


Align dimension 'B' with nearest cutting groove leaving at least last 2 rlbs visible.

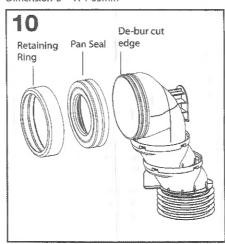


De-bur cut edge. Lubricate Pan Seal and push over Pan Connector end. Push Retaining Ring over Pan Seal.

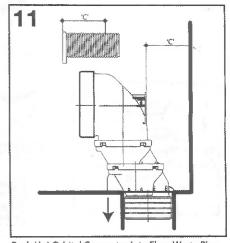


 Push Uni-Orbital Connector into Floor Waste Pipe Measure dimension 'C' - Pan Connector to finished wall. Cut Support Bar to length.




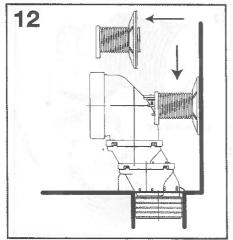

Wind Support Nut onto Support Bar. Push Support Bar into position.

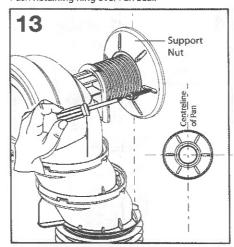

Screw Support Nut until flush with wall, Ensure slots are horizontal and fix to wall using the screws provided.

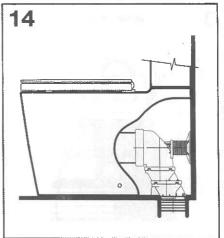

Refer to Pan instructions to complete installation.